

OREGON CORNER RESTORATION FORM

COUNTY: Umatilla DATE: 07/12/13

CORNER DESIGNATION: 3N32, T13, The West One-Quarter Corner of Section 27.

PREVIOUS RENEWALS/SURVEYS ETC.: Corner originally established by David Chaplin, under GLO Contract dated September 1864, notes state: Set post for 1/4 Sec. corner in mound of Earth with charred stake, pits, trench &c as per instructions. Survey 97-172-B, by David Haddock states: "monument from Survey 89-76-A, not found". Survey 06-606-C, by Stephen Haddock, states: "Corner point calculated using data from survey of record. No monument found or set." The survey of record refers to Survey No. 89-76-A, by David Krumbein.

MONUMENT AND ACCESSORIES FOUND: None.

MONUMENT MARKING DETAIL: Set a railroad spike marked as noted below.

MONUMENT SET: Held the position calculated per Survey 06-606-C as best remaining evidence of the original corner position. The position was calculated from ties to Survey No. 06-606-C. At the corner point, set a railroad spike stamped "+ PLS 54657", 1" below asphalt surface from which:

A 3/4" brass washer stamped "PLS 1106" in stop sign post bears North 68 1/2° East, 52.8 feet.

A 3/4" brass washer stamped "PLS 1106" in PP&L pole #270460, bears South 59° East, 57.7 feet.

A 3/4" brass washer stamped "PLS 1106" in PP&L pole #289460, bears South 68° West, 59.8 feet.

A 3/4" brass washer stamped "PLS 1106" in Highway 37 road sign post bears North 46° West, 47.3 feet.

Attached bearing object tags to all accessories.

LOCATION AND COMMENTS: Located at the intersection of road centerlines of Snyder Road and Highway 37.

OREGON STATE PLANE COORDINATE, North Zone, NAD 83(91), International Feet:

N= 749761.76'

E= 8634382.45'


FIRM: Wells Surveying
P.O. Box 1696
Pendleton, OR 97801

COMPASS DECLINATION: 18° East

Surveyor's Seal

Witnesses: Jason Wells, PLS

\3N32T13

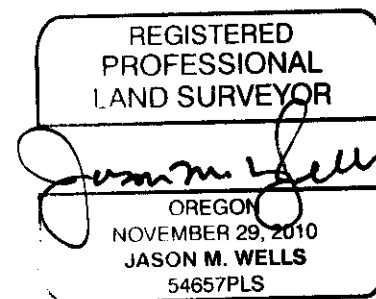

RENEWS: 6-30-14