

OREGON CORNER RESTORATION FORM

Section: 34 Township: 3N Range: 33E
County: Umatilla Date: 12/15/2011

Corner Designation: 3N33Z15

South quarter corner of Section 34 only.

	Condition Report Only
X	Not Found
X	Remonumented
	Unrecorded
X	Surveyed In
X	Referenced Out

Previous Renewals / Surveys, etc.


Originally surveyed by Thompson in 1864. He set a 17" x 8" x 6" stone.
In 1871 Moody set a 16" x 14" x 12" stone.
In 1887 Currin and Noland set an 18" x 10" x 8" basalt stone with pits and a mound of earth.

Monuments and Accessories Found: (Condition and Source):

None.

Diagram

Sketch

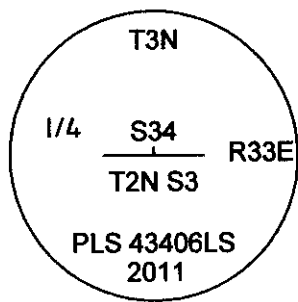

ORANGE MAGNET

SILVER MAGNET

FIELD LINE

BC

BLUE MAGNET

PINK MAGNET

NAD 83/91
OREGON STATE PLANE NORTH
INTERNATIONAL FEET

N742481.31
E8668907.04

Monument(s) Set (Procedures and Description):

A 1 1/8" x 30" galvanized iron pipe with 2 1/2" brass cap, stamped as shown above, 1.6' below the surface. The corner location was reestablished by single proportionate method between found monuments East and West.

References Set:

- "Deep One" magnets by Bermtsen.
- An orange magnet lies N 40° 30' W, 24.57', 1.7' deep.
- A silver magnet lies N 44° 30' E, 24.89', 1.7' deep.
- A pink magnet lies S 51° E, 24.91', 1.7' deep.
- A blue magnet lies S 39° 40' W, 25.64', 1.6' deep.

Location and Comments:

The corner is located 1 mile South and 1/2 mile East of the intersection of Hwy. 11 and South Market Rd.

Compass Declination

17° E

Surveyors Seal

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. English
OREGON
JANUARY 11, 2005
ROBERT DOUGLAS ENGLISH
43406LS

RENEWAL DATE: 12/31/13

RECEIVED BY:

Firm / Agency

Date: 7/10/2012
Rec'd By: [Signature]
No. 12-097-C

Survey One, LLC.
P.O. Box 382
Pendleton, OR 97801
(541) 276-2055