

OREGON CORNER RESTORATION FORM

Section: 24, 19
County: Umatilla

Township: 3N
Date: 1/11/2012

Range: 33E, 34E

Corner Designation: 3N33P25

Quarter corner common to Sections 24, T3NR33E; 19, T3NR34E.

_____	Condition Report Only
X	Not Found
X	Remonumented
_____	Unrecorded
X	Surveyed In
X	Referenced Out


Previous Renewals / Surveys, etc.

Originally surveyed by Thompson in 1864. He set a post in a mound of earth, with charred stake, pits, and a trench.
In 1871 Moody set a post in a mound of earth.


Monuments and Accessories Found: (Condition and Source):

None.

Diagram

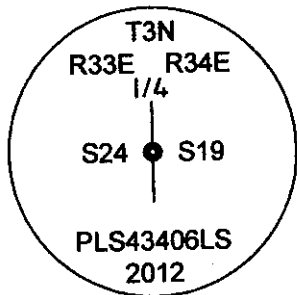

Sketch

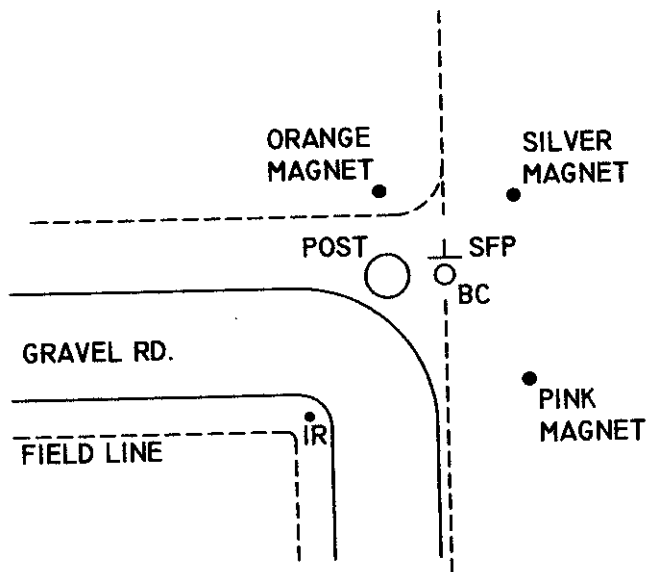

NAD 83/91
OREGON STATE PLANE NORTH
INTERNATIONAL FEET

N756036.72
E8681775.01

Monument(s) Set (Procedures and Description):

A 1 1/8" x 30" galvanized iron pipe with 2 1/2" brass cap, stamped as shown above, 1.5' East of a post, flush with the surface.
The corner location was reestablished by single proportionate method between neighboring corners to the North and South.

References Set:

- "Deep One" magnets by Berntsen.
- An orange magnet lies N 35° 50' W, 21.75', 1.7' deep.
- A silver magnet lies N 43° 10' E, 21.76', 1.6' deep.
- A pink magnet lies S 37° E, 28.00', 1.6' deep.
- A 5/8" x 30" iron rebar w/RPC #43406 lies S 46° W, 40.72', on the shoulder of a gravel road.

Location and Comments:

The corner is located 1 1/2 miles East-Northeast of the intersection of Hwy. 11 and Tubbs Ranch Rd., at corner of USDA Ag Research gravel road.

Compass Declination
17° E

Surveyors Seal

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert Douglas English
OREGON
JANUARY 11, 2005
ROBERT DOUGLAS ENGLISH
43406LS

RENEWAL DATE: 12/31/13

RECEIVED BY:

Date: 7/10/2012
Rec'd By: S. Oles
No. 12-094-C

Firm / Agency

Survey One, LLC.
P.O. Box 382
Pendleton, OR 97801
(541) 276-2055